

Grants for Programmes of Major Works Round 2: 2021/22

Table of photographs showing the completed project

Please provide up to four pairs of 'before and after' images to demonstrate that the grant funded works are complete.

Name of the site	St Andrews Church Rockbourne
Address of the site	4 New Road, Rockbourne, Hampshire, SP6 3NN



Image taken before the repair work Date image taken: 19.03.2019	Image taken after the repair work Date image taken: 21.06.2022
	
<p>Location on building: Tower from south aisle roof</p> <p>Short description of the repair need: Timber frame tower repair, remove shingles & roof tiles to access & improve previous details.</p>	<p>Short description of work that was carried out to address the repair need: Shingles refitted over new s.w. sarking boards. Tiles refitted on new Type 1F felt over sarking boards, bat slates added, secret eaves venting detail added, new leadwork details.</p>



Image taken before the repair work

Date image taken: 15.03.2022



Image taken after the repair work

Date image taken: 19.05.2022



Location on building:

Short description of repair need: Structurally compromised timber frame to be repaired, retaining all sound timbers, piecing in where possible, treating beetle by paste & spray. Roof tiles, shingles & timber sarking removed for access.

Short description of work that was carried out to address the repair need:

New matching oak sections inserted or replaced where necessary to stabilize tower structure. The main repairs on the south side, with the head frame member replaced to east & west.



Image taken before the repair work

Date image taken: 15.03.2022



Image taken after the repair work

Date image taken: 21.06.2022



Location on building:

Short description of repair need: Death watch beetle & water damage / wet rot had structurally compromised the timber frame. Localised repairs to oak frame & replacement where necessary.

Short description of work that was carried out to address the repair need:

Oak top frame beam replaced on east & west sides only. SW sarking boards replaced with new, beneath reused clay tiling & vertical oak shingles.



Image taken before the repair work

Date image taken: 15.03.2022



Image taken after the repair work

Date image taken: 19.05.2022



Location on building: Top frame with roof removed

Short description of repair need: Replacement of main beam & top frame beams to east & west where not structurally sound due to death watch beetle & wet rot decay.

Short description of work that was carried out to address the repair need: Main beam replaced in oak to the same profile & details, along with east & west head frame beams, vertical post and some braces. SW rafters reused and 1 new rafter added.