

Grants for Programmes of Major Works Round 2: 2021/22

Table of photographs showing the completed project

Please provide up to four pairs of 'before and after' images to demonstrate that the grant funded works are complete.

| | |
|----------------------------|---|
| Name of the site | St Stephen the Martyr church |
| Address of the site | St Stephen's hill, St Stephens, Launceston, Cornwall. |

| Image taken before the repair work Date image taken: 11.12.19 | Image taken after the repair work Date image taken: 26.07.22 |
|---|---|
|  |  |
| <p>Location on building: Organ roof, South east corner.</p> <p>Short description of the repair needed: Insufficient gutter depth, failed lead parapet capping; failed rainscreen sheeting, failed lead.</p> | <p>Short description of work that was carried out to address the repair needed: New lead parapet capping including removal and replacement of merlons, parapet consolidation, new lead shallower roof pitch to allow deeper gutter profile, vertical lead to replace corrugated tin, larger areas of exposed parapet wall has been prepared for harling rendering in lime.</p> |

| <p>Image taken before the repair work Date image taken: 11.12.19</p> | <p>Image taken after the repair work Date image taken: 26.07.22</p> |
|---|--|
|  |  |
| <p>Location on building: North parapet wall, nave west end. Short description of repair needed: Rotten roof timbers, split flashings, poorly maintained and unstable parapet.</p> | <p>Short description of work that was carried out to address the repair needed: Parapet depointed, consolidated and repointed in a lime mortar. Preparation for final dressing and completion to repair works outside of the grant works. The same works undertaken on the southern parapets including lifting merlons and reintroducing lead DPCs.</p> |

| <p>Image taken before the repair work Date image taken: 11.12.19</p> | <p>Image taken after the repair work Date image taken: 26.07.22</p> |
|--|--|
|  |  |
| <p>Location on building: Northern parapet gutter and nave slope. Short description of repair needed: Failed and slipping lead sheeting, insufficient fall on gutter causing roof timber decay.</p> | <p>Short description of work that was carried out to address the repair needed: New shallower lead pitch to north slope of nave to allow for a deeper gutter profile and improved falls, timber repairs, new code 8 cast lead roof. Exactly the same work was undertaken on the South parapet gutter.</p> |

| <p>Image taken before the repair work Date image taken: 11.12.19</p> | <p>Image taken after the repair work Date image taken: 26.07.22</p> |
|---|---|
|  |  |
| <p>Location on building: Roof slopes of the Nave and south aisle and valley gutter. Short description of repair needed: Overlength failed lead sheeting, insufficient falls to the valley gutter and exposed masonry leading to timber decay.</p> | <p>Short description of work that was carried out to address the repair needed: New lead roof with shortened sheet lengths with staggered laps, vertical timber cladding and lead sheeting to cover the exposed walls, new lead gutter profile and increased number and height of steps.</p> |