



Energy Audit Report for St. Thomas' Church



Site Address	St. Thomas' Church, Salford, M6 6PE
Church Code	624144
Author	Tim Mawby Graduate Consultant
Date	18 th December 2019
Version	1.0

Contents

1	Executive Summary	3
2	Church Information.....	4
3	Energy Procurement Review	5
3.1	Electricity	5
3.2	Gas	5
4	Energy Usage Details	5
4.1	Cost & Consumption	5
4.2	Energy Benchmarking (Based on CofE Shrinking the Footprint – Energy)	5
5	Building Performance and Opportunities.....	6
5.1	Building Envelope.....	6
5.2	Heating System – Boilers	6
5.3	Heating System – Pipework and Distribution	6
5.4	Heating System – Heat Emitters	7
5.5	Hot Water System	8
5.6	Lighting	8
5.7	Renewables.....	10
6	Potential Saving Opportunities.....	11
7	Assumptions	11
7.1	Assumptions.....	11
7.2	Economic Life.....	12
7.3	Implementation.....	12
7.4	Cumulative Savings and Double Counting	12
8	Funding Sources	12
9	Faculty Requirements	12
10	Limitations.....	12

1 Executive Summary

An energy survey of St. Thomas' Church, Salford, M6 6PE was undertaken by ESOS Energy Ltd to provide advice to the Church on how it can be more energy efficient and provide a sustainable and comfortable environment to support its continued use. This audit has been provided in conjunction with 2buy2, the Church of England's Parish Buying scheme provider.

This energy audit has been undertaken by a suitably qualified and experienced energy auditor. Benefits of implementing the opportunities identified in this Report include a reduction in energy costs in the first instance, but could also reduce other costs, increase staff awareness and engagement, and improve comfort and staff satisfaction in the workplace.

The Church has a number of ways in which it can be more energy efficient. Our key recommendations have been summarised in the table below and are described in more detail later in this report. It is recommended that this table is used as the action plan for the church in implementing these recommendations over the coming years.

Energy Saving Measure	Annual Energy Savings (kWh)	Annual Cost Savings (£)	Estimated Capital Cost	Payback Period (Years)	Annual Carbon Savings (Tonnes CO ₂ e)
Replace the existing boilers with new condensing gas boilers	18,900	£567	£9,000	3.9	15.9
Replace insulating lagging on existing pipework	1,890	£57	£300	5.3	0.4
Replace water heater in the kitchen with efficient alternative	1,997	£200	£700	3.5	0.6
Church – replace 25W chandeliers with 3.5W LEDs	1073	£107	£300	2.8	0.3
Kitchen – replace 58W fluorescent tubes with 22W LED alternatives	60	£6	£20	3.3	<0.1
Dining – replace 58W fluorescent tubes with 22W LED alternatives	240	£24	£80	3.3	0.1
Entrance – replace 58W fluorescent tubes with 22W LEDs	150	£15	£50	3.3	<0.1
Entrance - replace chandelier (4x25W) with 3.5W LEDs	72	£7	£20	2.9	<0.1
TOTALS	24,382	£983	£10,470	3.7	10.7

The headline messages from the audit are:

- ▲ £10,470 investment in energy reduction measures would achieve an estimated annual saving of 24,382kWh (combined electric and gas).
- ▲ Based on current electricity and gas tariffs, this would result in an annual financial saving of £983.
- ▲ The simple payback period on this investment is 10.7 years.

The Church should check any faculty requirements with the DAC Secretary at the Diocese before commencing any works.

2 Church Information

A site survey was undertaken by Tim Mawby on Wednesday 4th December 2019. The survey was non-invasive (visual only) and entailed a general walk throughout the church areas, including back of house spaces and plant rooms.

Photograph 1: St. Thomas' Church External View



General Information	
Site Address	St. Thomas' Church, Ford Lane, Salford, M6 6PE
Listed Status	Grade II Listed
Building Age	Built in 1832
Floor Area	Approximately 600m ²
Usage	Typically 16 hours per week

3 Energy Procurement Review

Energy bills for gas and electricity have not been supplied. Estimated market rates for energy have been used to estimate consumption.

3.1 Electricity

Day Rate	10.00 p/kWh
----------	-------------

3.2 Gas

Rate	3.00 p/kWh
------	------------

The review has highlighted that there may be opportunities to gain environmental benefits from improved procurement of the energy supplies at this site.

We would therefore recommend that the Church obtains a quotation for its gas and electricity supplies from the CofE Parish Buying scheme (<https://www.parishbuying.org.uk/categories/energy/energy-basket>). This scheme only offers renewably sourced energy and therefore it is an important part of the process of making Churches more sustainable.

4 Energy Usage Details

4.1 Cost & Consumption

Energy Type	Annual kWh
Gas	Not Provided
Electricity	Not Provided

If not already in place, it is recommended that the Church consider asking their suppliers to install smart meters so that the usage can be monitored more closely, and the patterns of usage reviewed against the times the building is in use.

4.2 Energy Benchmarking (Based on CofE Shrinking the Footprint – Energy)

Energy Type	Size (Sqm)	Benchmark Energy Use (kWh/Sqm)	Actual Energy Use (kWh/Sqm)	Variance from Benchmark (%)
Gas	600	105	Not Provided	Not Provided
Electricity	600	20	Not Provided	Not Provided

5 Building Performance and Opportunities

The building is well run with proactive on-site team in terms of energy conversation with some areas of improvement already being identified. The following sections will highlight where further improvements could potentially be made.

5.1 Building Envelope

From visual inspection, the building envelope appears to be in a reasonable state of repair. Wall and roof insulation are not present.

5.2 Heating System – Boilers

Heating is provided to the church via 2no. Hamworthy gas fired boilers (installed in 1976) located in the basement plant room. The boilers' heating schedule is currently programmed to be active for 14 hours per week. Control panels are located throughout the church, allowing for manual overrides so that the system can be switched on outside of the programmed hours, as well as the changing of the temperature set point. Based on this, it is assumed that the efficiency of the boiler may have dropped to as little as 60%. As such, it is recommended that the boiler is replaced with a high efficiency gas condensing boiler.

It is recommended that the existing gas boilers be replaced with modern alternatives. Additionally, the client may consider exploring the possibility of installing an air to water heat pump heating system in order to move towards the goal of decarbonising energy consumption.

Photograph 2: Church Boilers



5.3 Heating System – Pipework and Distribution

The heating systems' plant room pipework is satisfactory, however some of the insulating lagging is in poor condition and sections are exposed. It is recommended that the existing lagging is removed, and the pipework is fitted with new lagging in order to reduce heat loss into the basement plant room.

Photographs 3 & 4: Heating Pipework



5.4 Heating System – Heat Emitters

Heating to the church is served via 8no. wall-mounted radiators. There are an additional 2no. radiators in the vestry, 4no. in the dining area, 3no. in the entrance space and 1no. in the kitchen. These radiators are supplied by heating pipes running in under the ground-floor in the basement (photograph 4). Radiators are typically obstructed by furniture which limits the effectiveness of the heating. It is advised that items are removed from the immediate vicinity to allow for better heat convection in the space.

A range of portable plug-in heaters are also present throughout the building and are used to provide additional heating to the smaller rooms when required. This can be an ineffective, inefficient and poorly controlled means of providing space heating, and can easily be left on when unoccupied. It is recommended that a more permanent heating solution be provided to these spaces if and when heating upgrades are undertaken.

Photographs 4 & 5: Church Heat Emitters



5.5 Hot Water System

Hot water is provided to the kitchen via a 8kW Sadia electric water heater (photograph 6). It is unclear how old the heater is, however during the site visit it was noted that the heater is in poor condition. Based on this, it is assumed that the efficiency of the heater may have dropped to as little as 60%. As such, it is recommended that it is replaced with a high efficiency electric water heater. There is also a Lincat electric point of use water heater located in the kitchen.

Hot water is provided to the WCs by a Heatrae Sadia Multipoint 15 electric water heater (photograph 7). Hot water consumption in WCs is considered to be nominal.

Photographs 6 & 7: Electric Water Heaters



5.6 Lighting


There is no lighting control system, motion detectors or daylight dimming controls. All light fittings are controlled via manual on/off switches.

The range of light fittings throughout the church areas are detailed below:

Church/Gallery

- ▲ 2no. chandeliers, consisting of 12no. 25W fluorescent lamps – recommended to be replaced with 3.5W LED alternatives.
- ▲ 9no. chandeliers, consisting of 4no. 25W fluorescent lamps – recommended to be replaced with 3.5W LED alternatives.
- ▲ 4no.7.5W LED spotlights.

Photographs 8, 9 & 10: Church Light Fittings

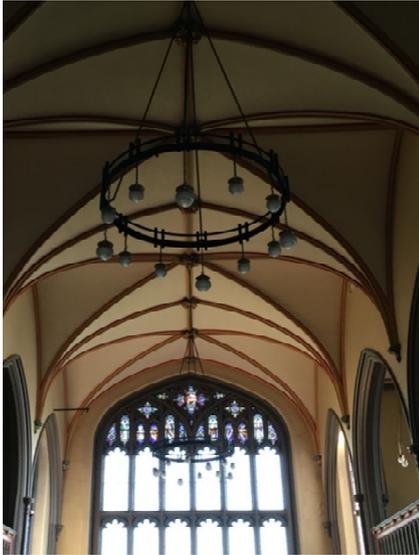

Vestry

- ▲ 9no. LED spotlights


Photograph 11: LED Spotlights



Kitchen

- ▲ 2no. 58W T8 fluorescent tubes – recommended to be replaced with 22W LED alternatives.

Photograph 12: Fluorescent Tube

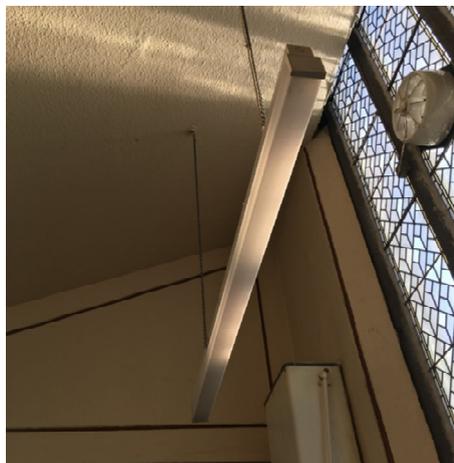


Dining Area

- ▲ 8no. 58W T8 fluorescent tubes – recommended to be replaced with 22W LED alternatives.

Entrance Area

- ▲ 2no. 3.5W LED pendant lamps
- ▲ 5no. 58W T8 fluorescent tubes – recommended to be replaced with 22W LED alternatives.
- ▲ 1no. chandelier, consisting of 4no. 25W fluorescent lamps – recommended to be replaced with 3.5W LED alternative.

Photograph 13: LED Hanging Lamps

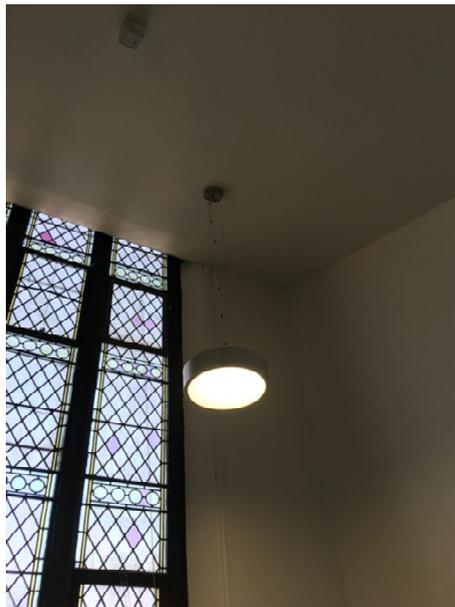

WCs

- ▲ 6no. 3.5W LED pendant lamps

5.7 Renewables

There are currently no renewables on-site. A free desktop survey can be carried out by a specialist solar installer to identify the possibility of installing solar PV panels.

6 Potential Saving Opportunities

As part of the assessment, we carry out a close inspection of M&E plant and their associated controls, with the aim of identifying any issues that have significant impact on energy consumption and correct building operation. We have reviewed the building and associated HVAC and lighting operations and identified the following potential energy conservation opportunities (ECOs), which should be investigated:

Category	Actions	Potential Annual Savings			Investment (£)	Simple payback (yrs.)
		Elec/Gas (kWh)	Cost (£)	(tCO ₂)		
Heating	Replace the existing boilers with new condensing gas boilers (90% efficiency)	18,900	£567	3.9	£9,000	15.8
Heating	Replace insulating lagging on existing pipework (estimated 3% saving)	1,890	£57	0.4	£300	5.3
Hot Water	Replace the water heater in the kitchen with new electric water heater (90% efficiency)	1,997	£200	0.6	£700	3.5
Lighting	Church/Gallery – replace chandeliers (12x25W) with 3.5W LED alternatives.	429	£43	0.1	£120	2.8
Lighting	Church/Gallery - replace chandeliers (4x25W) with 3.5W LED alternatives.	644	£64	0.2	£180	2.8
Lighting	Kitchen – replace 58W fluorescent tubes with 22W LED alternatives.	60	£6	<0.1	£20	3.3
Lighting	Dining Area – replace 58W fluorescent tubes with 22W LED alternatives.	240	£24	0.1	£80	3.3
Lighting	Entrance – replace 58W fluorescent tubes with 22W LED alternatives.	150	£15	<0.1	£50	3.3
Lighting	Entrance - replace chandelier (4x25W) with 3.5W LED alternative.	72	£7	<0.1	£20	2.9
TOTAL ELECTRICITY SAVINGS		3,592	£359	1.1	£1,170	3.3
TOTAL GAS SAVINGS		20,790	£624	4.3	£9,300	14.9
GRAND TOTAL		24,382	£983	5.4	£10,470	10.7

7 Assumptions

7.1 Assumptions

- ▲ Costs excludes labour, installation and access which will require the confirmation of a specialist contractor.
- ▲ Average cost of electricity at 10.00p/kWh.

- ▲ Average cost of gas at 3.00p/kWh.
- ▲ Electricity carbon emission rate of 0.31598 kgCO₂/kWh.
- ▲ Natural Gas carbon emission rate of 0.20776 kgCO₂/kWh.

7.2 Economic Life

CIBSE Guide M Appendix 12.A1 gives the economic life of plant common plant items. After this time the maintenance and repair make it economic to replace the asset. There will be energy savings inherent in the new equipment and the need to meet the minimum requirements of the Building Regulations. Some capital plant has long payback periods, when based on energy efficiency alone, but these should be part of an asset replacement programme with only the 'additional' cost of higher than minimum required energy standards being used to calculate ROI.

7.3 Implementation

Reviews of Energy Projects and Initiatives are designed to provide a high-level indication of options available clients and will not constitute a recommendation for implementation. Pricing and potential savings are indicative values and will not constitute an offer.

7.4 Cumulative Savings and Double Counting

It should be noted that further investigation may rule out some measures as impractical, either physically or financially. Some measures are mutually exclusive and provide diminishing returns if implemented together. For example, if the lighting load is reduced through more efficient lighting, there will be an increase in the heat demand on boilers, as the new lights generate less heat.

Each energy conservation measure is assessed independently at this stage so that they can be fairly compared. An assessment of any overlap will be undertaken once any projects are selected for implementation.

8 Funding Sources

There are a variety of charitable grants for Churches undertaking works and a comprehensive list of available grants is available at:

<https://www.parishresources.org.uk/wp-content/uploads/Charitable-Grants-for-Churches-Nov-2019.pdf>

9 Faculty Requirements

It must be noted that all works intended to be undertaken should be discussed with the DAC at the Diocese.

Minor works can be undertaken without the need for consultation and would include changing of light bulbs within existing fittings, repair and maintenance works to heating and electrical systems and repairs to the building which do not affect the historic fabric.

Major works which can be undertaken without a faculty but must be consulted on with permission sought from the Archdeacon through the DAC. This includes works of adaptation (but not substantial addition or replacement) of heating and electrical systems and also the replacement of existing boilers so long as the same pipe work, fuel source and flues are used, It can also be used to replace heating controls.

All other works will be subject to a full faculty.

Works which affect the external appearance of the church will also require planning permission (but not listed building consent) from the local authority and this will be required for items such as PV installations,

10 Limitations

The recommendations contained in this Report represent ESOS Energy's professional opinions, based upon the information listed in the Report, exercising the duty of care required of an experienced Sustainability Consultant.

ESOS Energy obtained, reviewed and evaluated information in preparing this Report from the Client and others. ESOS Energy conclusions, opinions and recommendations has been determined using this information. ESOS Energy does not warrant the accuracy of the information provided to it and will not be responsible for any opinions which ESOS Energy has expressed, or conclusions which it has reached in reliance upon information which is subsequently proven to be inaccurate.

This Report was prepared by ESOS Energy for the sole and exclusive use of the Client and for the specific purpose for which ESOS Energy was instructed. Nothing contained in this Report shall be construed to give any rights or benefits to anyone other than the Client and ESOS Energy, and all duties and responsibilities undertaken are for the sole and exclusive benefit of the Client and not for the benefit of any other party. In particular, ESOS Energy does not intend, without its written consent, for this Report to be disseminated to anyone other than the Client or to be used or relied upon by anyone other than the Client. Use of the Report by any other person is unauthorised and such use is at the sole risk of the user. Anyone using or relying upon this Report, other than the Client, agrees by virtue of its use to indemnify and hold harmless ESOS Energy from and against all claims, losses and damages (of whatsoever nature and howsoever or whensoever arising), arising out of or resulting from the performance of the work by the Consultant.